

HIGH PURITY PRESSURE TRANSDUCERS



- LED Status Indicator
- Compound Range Available
- 5 Year Warranty
- UL 61010-1 Safety Requirement Compliant
- Optional UL/ATEX Class I and II Division 2 and Class III Div. 1 and 2

PRECISION SENSORS



OVERVIEW


Precision Sensors XHP Series High Purity Transducer is designed for accurate, reliable, long-term sensing of process gases used in the manufacturing of semiconductor products. LED status light verifies that the transducer is operating correctly. Color band labels are provided with the unit to allow the installer to mark and identify the measured gas. Precision Sensors products are designed and manufactured to the requirements of AS/EN/JISQ9100:2009 and ISO 9001:2008 Quality Management System.


FEATURES

- Optional Hazardous Location Compatibility
- LED Status Indicator
- 5 Million Cycle Life
- Ranges from 100 to 3000 PSIG
- Compound Range Available for Vacuum Measurement
- 5 Year Warranty
- CE Marked Conforms to EMC Directive 20104/108/EC
- RoHS Compliant

MODEL	RANGE*	PROOF PRESSURE	BURST PRESSURE		
XHPA	0 to 100 psi gauge/0 to 689 kPa gauge	150 psi gauge/1034 kPa gauge	300 psi gauge/2068 kPa gauge		
XHPB	0 to 250 psi gauge/0 to 1724 kPa gauge	375 psi gauge/2585 kPa gauge	750 psi gauge/52 bar gauge		
XHPC	0 to 500 psi gauge/0 to 34 bar gauge	750 psi gauge/52 bar gauge	1500 psi gauge/103 bar gauge		
XHPD	0 to 1000 psi gauge/0 to 69 bar gauge	1500 psi gauge/103 bar gauge	3000 psi gauge/207 bar gauge		
XHPE	0 to 3000 psi gauge/0 to 207 bar gauge	4500 psi gauge/310 bar gauge	9000 psi gauge/620 bar gauge		

^{*}Ranges are scalable to any intermediate value. For example, the 0-500 psig range unit is scalable to 0-456 psig full scale output range; or, range may be scaled to allow for conversion to standard metric unit ranges (e.g. 0.5 MPa = 72.52 psi).

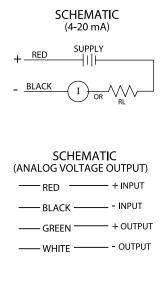

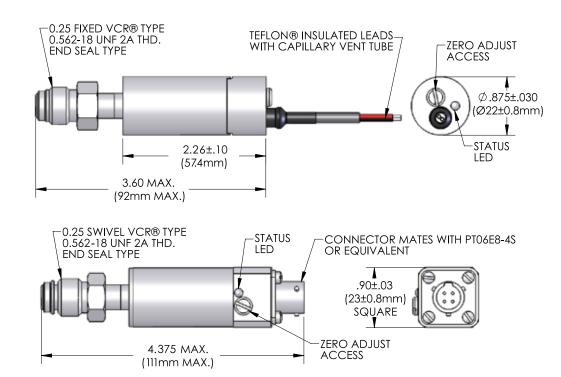

TECHNICAL SPECIFICATIONS				
Output	4-20 mA, 0-5 VDC, 1-5 VDC	Proof Pressure	1.5x Rated Pressure	
Supply Voltage	12-30 VDC	Burst Pressure	3x Rated Pressure	
Accuracy (Total Error Band)	\pm 0.5% FS from 15 to 30 °C \pm 2% FS from 0 to 45 °C	Surface Finish	10 Ra Max	
Compensated Temperature Range	Compensated Temperature Range 0-45°C		0.075 Inch ³	
Operating Temperature Range	Operating Temperature Range 0-55°C		IP54	
Wetted Materials	Wetted Materials 316L Stainless Steel		<5msec	
Pressure Connection	1/4" Male VCR®, 1/4" Female VCR®, 1/4" Male Swivel VCR®, 1 1/8" Surface Mount C Seal per Semi F86	Cycle Life	5 Million Cycles Minimum	
Seal Integrity <1x10 ⁹ cc/ sec He		Electrical Connection	Free Leads 24 Inches Standard* Optional Integrated Connector	
Approvals: UL 61010-1 Part 1 General Requirements ANSI/ISA 12.12.01-2013 Nonincendive Class I and II Division 2 and Class III Div. 1 and 2, Groups A, B, C, D, IEC 80079-34, IECEx UL 15.0034U Ex ic IIC Gc, 0°C< Tamb <55°C				

VCR is a Registered Trademark of Swagelok

HOW TO SPECIFY

To create a part description, use the below format. An application drawing based on the information will be generated and submitted for user approval.

Туре	Measurement Range	Pressure Connection	Electrical Connection	Lead Length		Analo Outp			Option		Option
XHP	В	VM	L	24		A			CP		217
	Code	e	Description	XHP	В	VM	L	24	A	CP	217
Туре											
Measuren	XHP		High Purity Transduce	er							
Range	A		0-100 psi gauge (0-68	39 kPa gauge)							
90	В		0-250 psi gauge (0-17								
	С		0-500 psi gauge (0-34								
	D		0-1000 psi gauge (0-6	59 bar gauge)							
	Е		0-3000 psi gauge (0-2	207 bar gauge)							
Pressure	Connection ———										
	VM		1/4" Male VCR®								
	VF		1/4" Female Swivel V	, ·							
	VSM		1/4" Male Swivel VCF	• •							
	SC		1 1/8" Surface Mount	t C Seal per Sem	ni F86	-0304					
Electrical	Connection —										
	L		Free Leads (Standard)								
	C		Crimp Type Connector		es Sta	ndard)					
Lead Leng	athB		Bendix Type Connecto	or							
		ify in Inches	24" is Standard								
Analog O	utput —		2 1 13 3 6 6 1 6 1 6 1								
	A		4-20 mA								
	V		0-5 VDC								
Options _	V1		1-5 VDC								
options :	СР		Compound option uses	s -15 psig as low	end o	of range				·	
	*	*I Intermediate range assigns full scale output to any value of the output range, use number to indicate option			e,						
	HL		Hazardous Locations - Nonincendive Class I a IECEx UL15.0034U Ex	nd II Division 2	and C	lass III Div					
			* When an intermediate rang	ge is specified the ac	curacy i	s decreased.					

The specified example denotes a transducer using 1/4" male VCR® type pressure connection with an electrical interface consisting of 24" free leads. A 4-20 mA analog output is provided. The compound option indicates the unit will sense negative gauge pressure to -15 psig. The intermediate range assigns the full scale output (20 mA) to 217 psig; as such, the output will be 4-20 mA from -15 to 217 psig.

^{*2} wires for 4-20 mA, 4 wires for voltage



ASK AN ENGINEER

GENERAL INFORMATION						
Full Name	Phone Number					
Company Name	Fax Number					
	E-Mail Address					

Submit

HOW TO SPECIFY

- 1 Call us at 203.877.2795 and ask for an engineer.
- 2 Locate our representative in your area via our website.
- Utilize our "Ask An Engineer" form at www.precisionsensors.com.

OR... E-MAIL US AT

Sales Department:

sales@precisionsensors.com

Technical Department:

askanengineer@precisionsensors.com

Service Department:

servicedepartment@precisionsensors.com

Quality Assurance:

quality@precisionsensors.com



Precision Sensors Division

340 Woodmont Road Milford, CT 06460 USA Telephone: 203 877 2795 Fax:

Telephone: 203.877.2795 Fax: 203.877.8752

Email: sales@precisionsensors.com www.precisionsensors.com



BHA1K 0120 XHP-AD1